



25		1810.86	938.64	4424.4	290.00	7,532.55	21,270.42	522.00	23,184.76
25-1202北卧窗北外墙漏水		314.32	161.02	738.6	50.00	1,274.63	3,408.12	90.00	3,714.86
窗口打胶		95.13	65.32	12.41	5.00	181.50	181.50	9.00	197.84
窗口原密封胶铲除，重新打硅宝结构耐候胶		95.13	65.32	12.41	5.00	181.50	181.50	9.00	197.84
堵漏		97.28	45.37	8.54	5.00	158.75	158.75	9.00	173.04
采用YH东方雨虹对缝隙堵漏		97.28	45.37	8.54	5.00	158.75	158.75	9.00	173.04
接缝处打胶		11.65	14.51	4.21	5.00	31.89	232.15	9.00	253.05
对窗台与外墙面接缝处，原密封胶铲除，重新打硅宝结构		11.65	14.51	4.21	5.00	31.89	232.15	9.00	253.05
垃圾清理		13.16		3.52	5.00	17.51	17.51	9.00	19.09
人工清理建筑垃圾并装袋，垂直运输短驳		13.16		3.52	5.00	17.51	17.51	9.00	19.09
垃圾装车外运		31.25		700	5.00	767.81	767.81	9.00	836.91
自卸汽车运土（8t以内）（运距25km以内）		31.25		700	5.00	767.81	767.81	9.00	836.91
砂浆抹面找平		14.36	8.25	2.13	5.00	25.98	283.70	9.00	309.23
采用立邦抗裂防水砂浆，对墙面进行找平		14.36	8.25	2.13	5.00	25.98	283.70	9.00	309.23
涂刷防水涂料2遍		19.86	11.76	2.13	5.00	35.44	709.51	9.00	773.37
涂刷东方雨虹HCA-108屋面外墙高弹性防水涂料1.5mm厚		19.86	11.76	2.13	5.00	35.44	709.51	9.00	773.37
涂刷界面剂		4.77	7.65	1.26	5.00	14.36	261.35	9.00	284.87
墙面界面处理剂		4.77	7.65	1.26	5.00	14.36	261.35	9.00	284.87
外墙表面铲除清理		14.73		2.43	5.00	18.02	327.93	9.00	357.48
对原墙面修灰、起皮的地方进行铲除		14.73		2.43	5.00	18.02	327.93	9.00	357.48
外墙涂料		12.13	8.16	1.97	5.00	23.37	467.87	9.00	509.98
外墙涂料一底二面		12.13	8.16	1.97	5.00	23.37	467.87	9.00	509.98
25-1301主卧飘窗外墙		314.32	161.02	738.6	50.00	1,274.63	3,153.43	90.00	3,437.24
窗口打胶		95.13	65.32	12.41	5.00	181.50	181.50	9.00	197.84
窗口原密封胶铲除，重新打硅宝结构耐候胶		95.13	65.32	12.41	5.00	181.50	181.50	9.00	197.84
堵漏		97.28	45.37	8.54	5.00	158.75	158.75	9.00	173.04
采用YH东方雨虹对缝隙堵漏		97.28	45.37	8.54	5.00	158.75	158.75	9.00	173.04
接缝处打胶		11.65	14.51	4.21	5.00	31.89	186.24	9.00	203.00
对窗台与外墙面接缝处，原密封胶铲除，重新打硅宝结构		11.65	14.51	4.21	5.00	31.89	186.24	9.00	203.00
垃圾清理		13.16		3.52	5.00	17.51	87.53	9.00	95.43
人工清理建筑垃圾并装袋，垂直运输短驳		13.16		3.52	5.00	17.51	87.53	9.00	95.43
垃圾装车外运		31.25		700	5.00	767.81	767.81	9.00	836.91
自卸汽车运土（8t以内）（运距25km以内）		31.25		700	5.00	767.81	767.81	9.00	836.91
砂浆抹面找平		14.36	8.25	2.13	5.00	25.98	227.53	9.00	248.06
采用立邦抗裂防水砂浆，对墙面进行找平		14.36	8.25	2.13	5.00	25.98	227.53	9.00	248.06
涂刷防水涂料2遍		19.86	11.76	2.13	5.00	35.44	620.91	9.00	676.79
涂刷东方雨虹HCA-108屋面外墙高弹性防水涂料1.5mm厚		19.86	11.76	2.13	5.00	35.44	620.91	9.00	676.79
涂刷界面剂		4.77	7.65	1.26	5.00	14.36	209.63	9.00	228.53
墙面界面处理剂		4.77	7.65	1.26	5.00	14.36	209.63	9.00	228.53
外墙表面铲除清理		14.73		2.43	5.00	18.02	263.09	9.00	286.77
对原墙面修灰、起皮的地方进行铲除		14.73		2.43	5.00	18.02	263.09	9.00	286.77
外墙涂料		12.13	8.16	1.97	5.00	23.37	450.31	9.00	490.87
外墙涂料一底二面		12.13	8.16	1.97	5.00	23.37	450.31	9.00	490.87
25-1502阳台台外墙		314.32	161.02	738.6	50.00	1,274.63	3,455.06	90.00	3,766.66
窗口打胶		95.13	65.32	12.41	5.00	181.50	363.00	9.00	395.67
窗口原密封胶铲除，重新打硅宝结构耐候胶		95.13	65.32	12.41	5.00	181.50	363.00	9.00	395.67
堵漏		97.28	45.37	8.54	5.00	158.75	158.75	9.00	173.04
采用YH东方雨虹对缝隙堵漏		97.28	45.37	8.54	5.00	158.75	158.75	9.00	173.04
接缝处打胶		11.65	14.51	4.21	5.00	31.89	197.72	9.00	215.51
对窗台与外墙面接缝处，原密封胶铲除，重新打硅宝结构		11.65	14.51	4.21	5.00	31.89	197.72	9.00	215.51
垃圾清理		13.16		3.52	5.00	17.51	87.53	9.00	95.43
人工清理建筑垃圾并装袋，垂直运输短驳		13.16		3.52	5.00	17.51	87.53	9.00	95.43
垃圾装车外运		31.25		700	5.00	767.81	767.81	9.00	836.91
自卸汽车运土（8t以内）（运距25km以内）		31.25		700	5.00	767.81	767.81	9.00	836.91

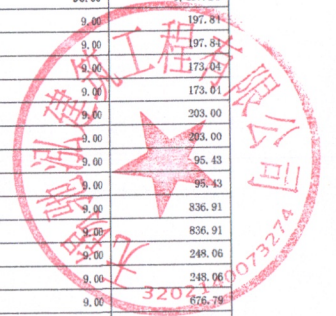

砂浆抹面找平	14.36	8.25	2.13	5.30	25.98	241.61	9.00	263.35
采用立邦抗裂防水砂浆,对墙面进行找平	14.36	8.25	2.13	5.30	25.98	241.61	9.00	263.35
涂刷防水涂料2遍	19.96	11.76	2.13	5.30	35.44	659.18	9.00	718.51
涂刷东方雨虹HCA-108屋面外墙高弹性防水涂料1.5mm厚	19.96	11.76	2.13	5.30	35.44	659.18	9.00	718.51
涂刷界面剂	4.77	7.65	1.26	5.30	14.36	222.66	9.00	242.61
提高界面处理剂	4.77	7.65	1.26	5.30	11.36	222.66	9.00	242.61
外墙表面铲除清理	14.73		2.43	5.30	18.02	279.31	9.00	304.45
对原墙面落灰、起皮的地方进行铲除	14.73		2.43	5.30	18.02	279.31	9.00	304.45
外墙涂料	12.13	8.16	1.97	5.30	23.37	478.15	9.00	521.18
外墙涂料底漆一面	12.13	8.16	1.97	5.30	23.37	478.15	9.00	521.18
25-1801客厅窗户外墙	314.32	161.02	738.6	50.00	1,274.63	3,442.50	90.00	3,762.11
窗口打胶	95.13	55.32	12.41	5.30	181.50	363.00	9.00	395.67
窗口原密封胶铲除,重新打硅宝结构耐候胶	95.13	55.32	12.41	5.30	181.50	363.00	9.00	395.67
堵洞	97.28	45.37	8.54	5.30	158.75	158.75	9.00	173.04
采用YH东方雨虹对缝填堵剂	97.28	45.37	8.54	5.30	158.75	158.75	9.00	173.04
接缝处打胶	11.66	14.51	4.21	5.30	31.89	196.44	9.00	214.12
对窗台与外墙交接处,原密封胶铲除,重新打硅宝结构	11.66	14.51	4.21	5.30	31.89	196.44	9.00	214.12
垃圾清理	13.16		3.52	5.30	17.51	87.65	9.00	95.43
人工清理建筑垃圾并装袋,垂直运输短驳	13.16		3.52	5.30	17.51	87.65	9.00	95.43
垃圾装车外运	31.25		700	5.30	767.81	767.81	9.00	836.91
自卸汽车运土(8t以内)(运距25km以内)	31.25		700	5.30	767.81	767.81	9.00	836.91
砂浆抹面找平	14.36	8.25	2.13	5.30	25.98	240.06	9.00	261.67
采用立邦抗裂防水砂浆,对墙面进行找平	14.36	8.25	2.13	5.30	25.98	240.06	9.00	261.67
涂刷防水涂料2遍	19.96	11.76	2.13	5.30	35.44	654.93	9.00	713.87
涂刷东方雨虹HCA-108屋面外墙高弹性防水涂料1.5mm厚	19.96	11.76	2.13	5.30	35.44	654.93	9.00	713.87
涂刷界面剂	4.77	7.65	1.26	5.30	14.36	221.14	9.00	241.04
提高界面处理剂	4.77	7.65	1.26	5.30	11.36	221.14	9.00	241.04
外墙表面铲除清理	14.73		2.43	5.30	18.02	277.51	9.00	302.49
对原墙面落灰、起皮的地方进行铲除	14.73		2.43	5.30	18.02	277.51	9.00	302.49
外墙涂料	12.13	8.16	1.97	5.30	23.37	475.11	9.00	517.87
外墙涂料底漆一面二面	12.13	8.16	1.97	5.30	23.37	475.11	9.00	517.87
25-302卧室飘窗	239.26	133.54	731.4	40.00	1,159.40	4,029.19	72.00	4,391.81
表面垃圾清理	14.73		2.43	5.30	18.02	189.21	9.00	206.24
对原墙面垃圾清理	14.73		2.43	5.30	18.02	189.21	9.00	206.24
窗口打胶	95.13	55.32	12.41	5.30	181.50	363.00	9.00	395.67
窗口原密封胶铲除,重新打硅宝结构耐候胶	95.13	55.32	12.41	5.30	181.50	363.00	9.00	395.67
大理石窗台处打胶	11.66	14.51	4.21	5.30	31.89	609.69	9.00	729.96
大理石原密封胶铲除,重新打硅宝结构耐候胶	11.66	14.51	4.21	5.30	31.89	609.69	9.00	729.96
接缝处打胶	35.25	21.52	4.21	5.30	64.03	941.24	9.00	1,025.95
对大理石台与外墙交接处,原密封胶铲除,重新打硅宝	35.25	21.52	4.21	5.30	64.03	941.24	9.00	1,025.95
垃圾清理	13.16		3.52	5.30	17.51	70.01	9.00	76.31
人工清理建筑垃圾并装袋,垂直运输短驳	13.16		3.52	5.30	17.51	70.01	9.00	76.31
垃圾装车外运	31.25		700	5.30	767.81	767.81	9.00	836.91
自卸汽车运土(8t以内)(运距25km以内)	31.25		700	5.30	767.81	767.81	9.00	836.91
涂刷防水涂料2遍	33.32	24.54	3.36	5.30	64.28	877.42	9.00	956.39
涂刷东方雨虹HCA121透明防水涂料	33.32	24.54	3.36	5.30	64.28	877.42	9.00	956.39
涂刷界面剂	4.77	7.65	1.26	5.30	14.36	150.78	9.00	164.35
提高界面处理剂	4.77	7.65	1.26	5.30	14.36	150.78	9.00	164.35
25-401主卧飘窗外墙	314.32	161.02	738.6	50.00	1,274.63	3,781.72	90.00	4,122.08
窗口打胶	95.13	55.32	12.41	5.30	181.50	363.00	9.00	395.67
窗口原密封胶铲除,重新打硅宝结构耐候胶	95.13	55.32	12.41	5.30	181.50	363.00	9.00	395.67
堵洞	97.28	45.37	8.54	5.30	158.75	158.75	9.00	173.04
采用YH东方雨虹对缝填堵剂	97.28	45.37	8.54	5.30	158.75	158.75	9.00	173.04
接缝处打胶	11.66	14.51	4.21	5.30	31.89	227.06	9.00	247.60

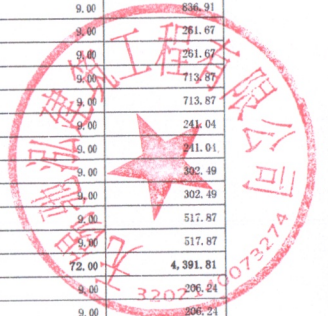

对窗台与外墙面接缝处，原密封铲除，重新打密封胶	11.85	14.51	4.21	5.30	31.89	227.06	9.00	247.50
垃圾清理	13.16		3.52	5.30	17.51	105.06	9.00	114.52
人工清理建筑垃圾并装袋，垂直运输卸袋	13.16		3.52	5.30	17.51	105.06	9.00	114.52
垃圾装车外运	31.25		700	5.30	767.81	767.81	9.00	836.91
自卸汽车运上（8L以内）（运距25km以内）	31.25		700	5.30	767.81	767.81	9.00	836.91
砂浆抹面找平	14.36	8.25	2.13	5.30	25.98	277.47	9.00	302.44
采用立邦抗裂耐水砂浆，对墙面进行找平	14.36	8.25	2.13	5.30	25.98	277.47	9.00	302.44
涂刷防水涂料2遍	19.96	11.76	2.13	5.30	35.44	757.00	9.00	835.13
涂刷东方雨虹K1108屋面外墙高弹性防水涂料1.5mm厚	19.96	11.76	2.13	5.30	35.44	757.00	9.00	835.13
涂刷界面剂	4.77	7.65	1.26	5.30	14.36	255.61	9.00	278.61
墙高界面处理剂	4.77	7.65	1.26	5.30	14.36	255.61	9.00	278.61
外墙表面铲除清理	14.73		2.43	5.30	18.02	320.76	9.00	349.63
对原墙面落灰、起皮的地方进行铲除	14.73		2.43	5.30	18.02	320.76	9.00	349.63
外墙涂料	12.13	8.16	1.97	5.30	23.37	549.20	9.00	598.63
外墙涂料一底二面	12.13	8.16	1.97	5.30	23.37	549.20	9.00	598.63

